

WARING
COMMERCIAL

Heavy Duty Citrus Juicers

JC3000 / no hood

JC4000 / with hood




019688

Name Plate

Unit Information

JC3000 - 1200 RPM's
5.5 Amps (*current production*)
4.8 Amps (*older units*)

JC4000 - 1800 RPM's
6.5 Amps (*current production*)
5.6 Amps (*older units*)

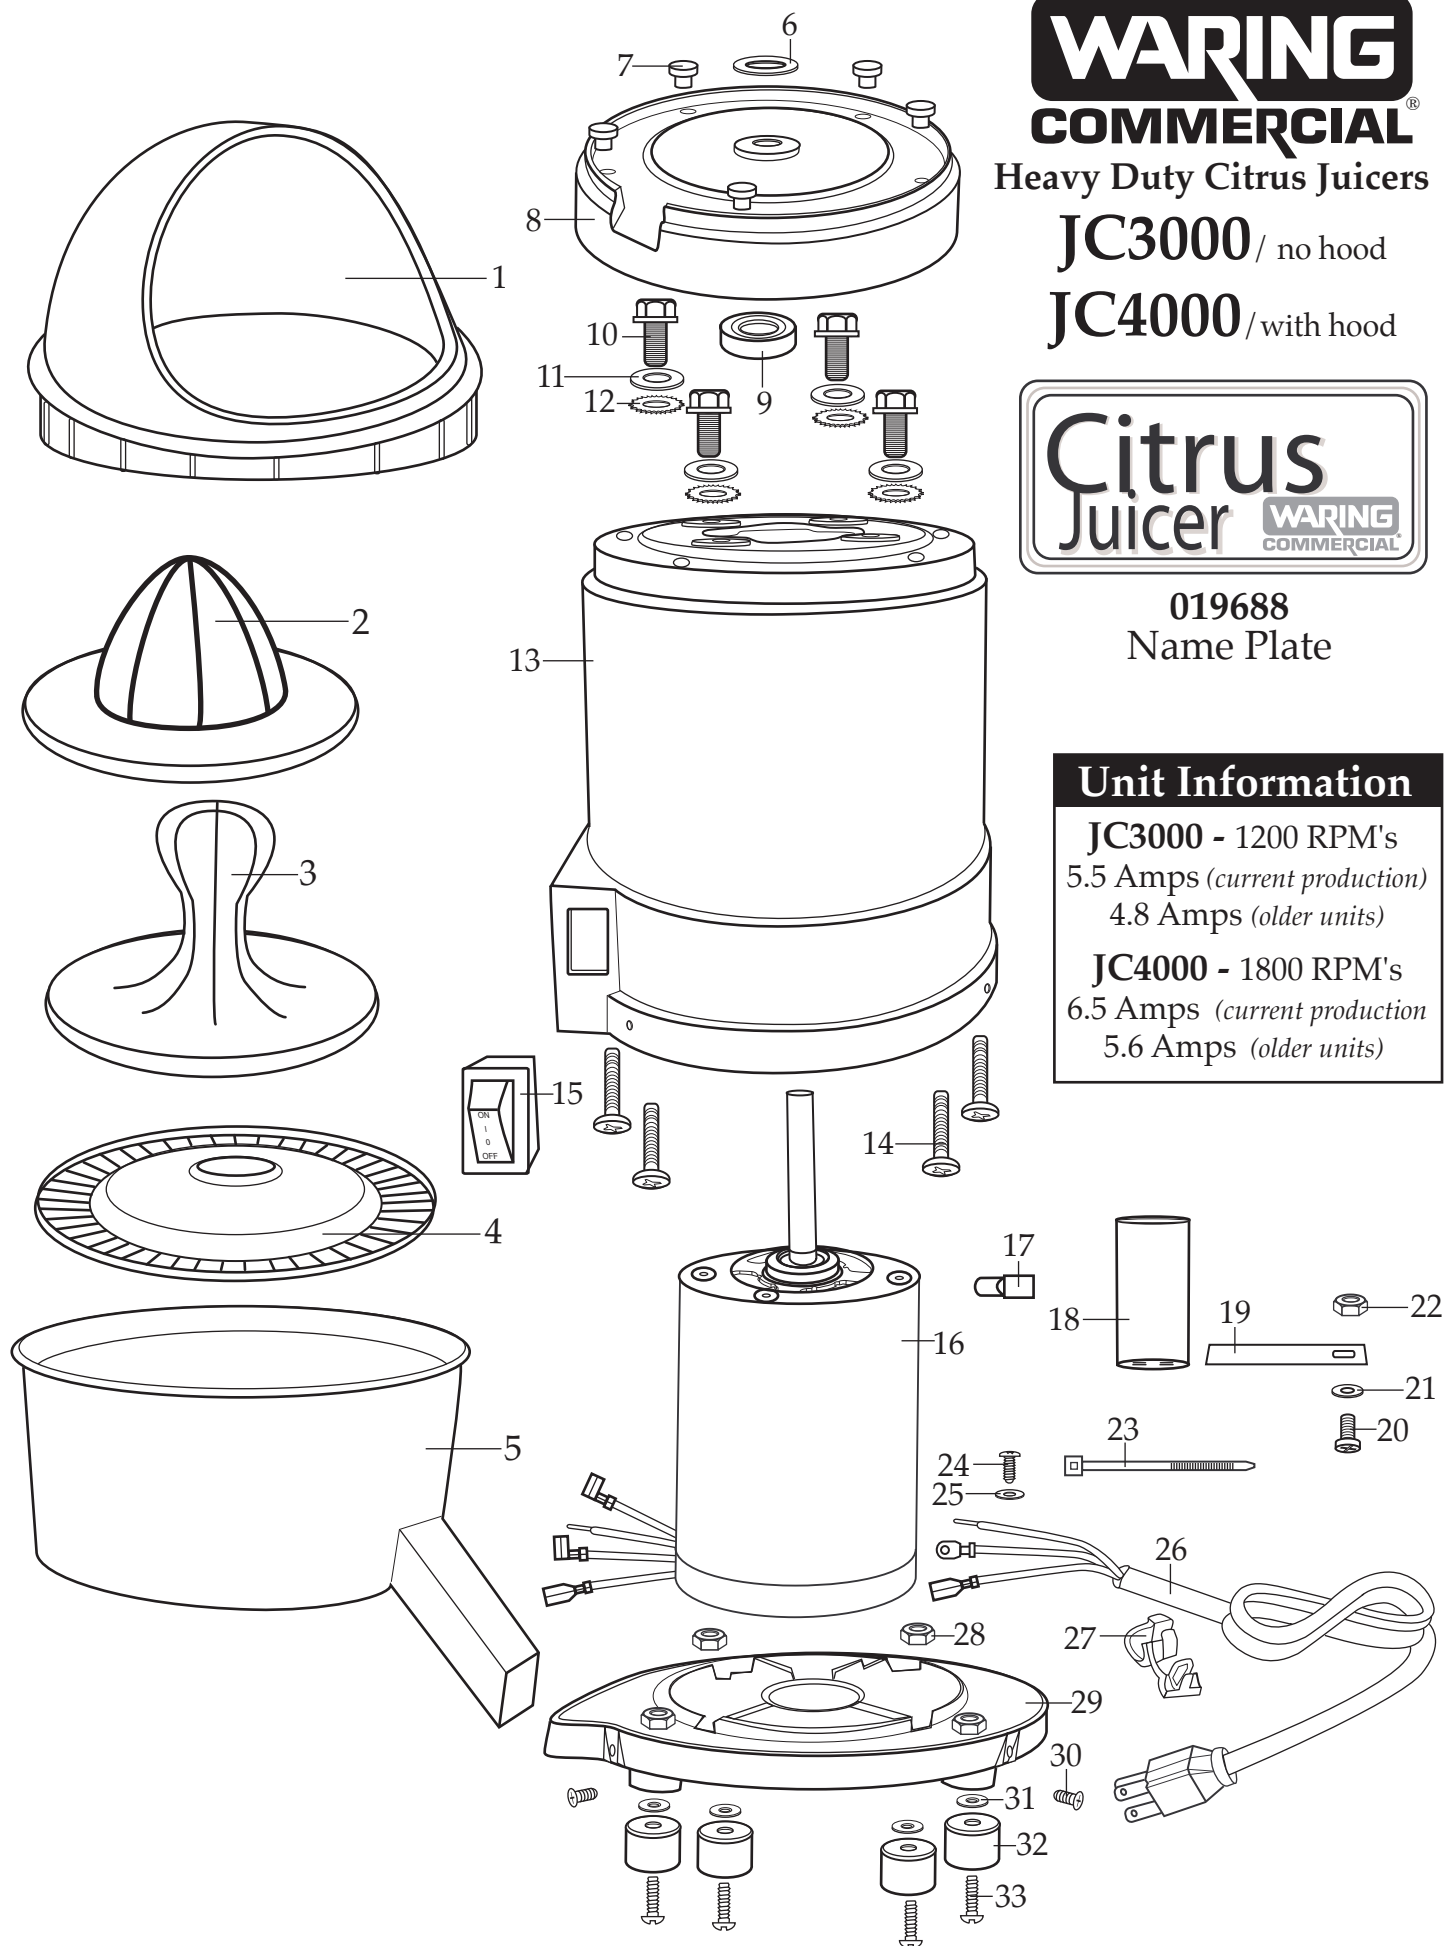

Catalog**Model**

	<i>current</i>	<i>older</i>
JC3000	JC3000	31JC32
JC4000	JC4000	31JC33

Waring Factory Service Center
 314 Ella T. Grasso Ave.
 Torrington, CT 06790
 Tele. 1-800-269-6640

Fax 860-496-9017
www.waringproducts.com



Illustration#	Part#	Description
1	501812	Juicer Hood /JC4000
2	017994	Reamer /large
3	018690	Reamer /small
4	017998	Strainer
5	017997	Bowl
6	018008	Washer
7	018608	Mounting Pad 5 Req.'d
8	018606	Adapter
9	018004	Seal (open end toward motor)
10	018009	Hex Head Screw 4 Req.'d
11	018313	Washer 4 Req.'d
12	018314	Lock Washer 4 Req.'d
13	017992	Base
14	018012	Screw 4 Req.'d
15	018003	Rocker Switch
16	028937	Motor /JC3000 (<i>current production</i>)
	018001	Motor /JC3000
	028935	Motor /JC4000 (<i>current production</i>)
	018114	Motor /JC4000
17	012409	Crimp Connector (<i>current production</i>)
18	029485	Motor Start Capacitor /JC3000 (<i>current production</i>)
	018116	Capacitor /JC3000
	029483	Motor Start Capacitor /JC4000 (<i>current production</i>)
	018118	Capacitor /JC4000
19	503291	Retainer Clip /JC3000 & JC4000 (<i>current production</i>)
	017999	Retainer Clip /JC3000
	018181	Retainer Clip /JC4000
20	018002	Screw
21	018013	Washer
22	002899	Hex Nut
23	013731	Cable Tie (<i>current production</i>)
24	027278	Screw /ground (<i>current production</i>)
25	002943	Washer /ground (<i>current production</i>)
26	503260	Cord Set (<i>current production</i>)
	501817	Cord Set


CatalogJC3000
JC4000**Model**

<i>current</i>	<i>older</i>
JC3000	31JC32
JC4000	31JC33

Waring Factory Service Center
314 Ella T. Grasso Ave.
Torrington, CT 06790
Tele. 1-800-269-6640

Fax 860-496-9017
www.waringproducts.com

Illustration#	Part#	Description
27	013680	Strain Relief
28	002899	Hex Nut 4 Req.'d
29	018068	Bottom Cover /JC3000
	018069	Bottom Cover /JC4000
30	018010	Screw 4 Req.'d
31	018013	Washer 4 Req.'d
32	018006	Foot 4 Req.'d
33	018011	Screw 4 Req.'d



501813 - Lead Assy. /brown (*older units*)

Wiring Diagram
(*current production*)

